

Issued in Kansas City, Missouri, on May 26, 2000.

Larry E. Werth,

*Acting Manager, Small Airplane Directorate,  
Aircraft Certification Service.*

[FR Doc. 00-14016 Filed 6-6-00; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 99-SW-45-AD; Amendment 39-11765; AD 2000-11-17]

RIN 2120-AA64

#### Airworthiness Directives; Eurocopter France Model SA-365N1, AS-365N2, and SA-366G1 Helicopters

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment supersedes an existing airworthiness directive (AD) that applies to Eurocopter France Model SA-365N1, AS-365N2, and SA-366G1 helicopters and that currently requires initial and repetitive inspections of the tail rotor blade Kevlar tie-bar (Kevlar tie-bar) for cracks or delaminations. This amendment requires the same actions required by the existing AD and corrects an incorrectly stated part number (P/N) in the existing AD. This amendment is prompted by a report of delamination of a Kevlar tie-bar. The actions specified by this AD are intended to detect cracks that could lead to delamination of the Kevlar tie-bar, loss of tail rotor control, and subsequent loss of control of the helicopter.

**DATES:** Effective July 12, 2000. The incorporation by reference of certain publications listed in the regulations was approved previously by the Director of the Federal Register as of June 11, 1998 (63 FR 25158, May 7, 1998).

**ADDRESSES:** The service information referenced in this AD may be obtained from American Eurocopter Corporation, 2701 Forum Drive, Grand Prairie, Texas 75053-4005; telephone (972) 641-3460, fax (972) 641-3527. This information may be examined at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Jim Grigg, Aviation Safety Engineer, FAA, Rotorcraft Directorate, Regulations Group, Fort Worth, Texas 76193-0111;

telephone (817) 222-5490, fax (817) 222-5961.

**SUPPLEMENTARY INFORMATION:** A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) by superseding AD 98-10-04, Amendment 39-10515 (63 FR 25158, May 7, 1998), which applies to Eurocopter France Model SA-365N1, AS-365N2, and SA-366G1 helicopters, was published in the **Federal Register** on March 9, 2000 (65 FR 12489). That action proposed to require the same actions required by the existing AD and correct an incorrectly stated P/N in the existing AD.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposal or the FAA's determination of the cost to the public. The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

The FAA estimates that 47 helicopters of U.S. registry will be affected by this AD, that it will take approximately 4 work hours per helicopter to accomplish the required actions, and that the average labor rate is \$60 per work hour. Required parts will cost approximately \$3,000 per blade. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$152,280 to replace one blade and perform one inspection on each helicopter.

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by removing Amendment 39-10515 (63 FR 25158), and by adding a new airworthiness directive (AD), Amendment 39-11765, to read as follows:

#### AD 2000-11-17 Eurocopter France:

Amendment 39-11765. Docket No. 99-SW-45-AD. Supersedes AD 98-10-04, Amendment 39-10515, Docket No. 97-SW-49-AD.

**Applicability:** Model SA-365N1, AS-365N2, and SA-366G1 helicopters, with tail rotor blade (blade), Part Number 365A12-010—all dash numbers, 365A12-0020-00, 365A33-2131—all dash numbers, or 365A12-0020-02, installed, certificated in any category.

**Note 1:** This AD applies to each helicopter identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For helicopters that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To detect cracks that could lead to delamination of the tail rotor blade Kevlar tie-bar (Kevlar tie-bar), loss of tail rotor control, and subsequent loss of control of the helicopter, accomplish the following:

(a) Within 10 hours time-in-service (TIS), and thereafter at intervals not to exceed 250 hours TIS, inspect each Kevlar tie-bar for a crack or delamination in accordance with paragraph B, Operational Procedure, of Eurocopter France Service Bulletin 05.00.34, Revision 3, dated November 14, 1996.

(b) If any delamination or cracking is found during any of the inspections required by paragraph (a) of this AD, remove the blade and replace it with an airworthy blade before further flight.

(c) An alternative method of compliance or adjustment of the compliance time that

provides an acceptable level of safety may be used if approved by the Manager, Regulations Group, Rotorcraft Directorate, FAA. Operators shall submit their requests through an FAA Principal Maintenance Inspector, who may concur or comment and then send it to the Manager, Regulations Group.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Regulations Group.

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the helicopter to a location where the requirements of this AD can be accomplished.

(e) The inspection shall be done in accordance with paragraph B, Operational Procedure, of Eurocopter France Service Bulletin 05.00.34, Revision 3, dated November 14, 1996. The incorporation by reference of that document was approved previously by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51, as of June 11, 1998 (63 FR 25158, May 7, 1998). Copies may be obtained from American Eurocopter Corporation, 2701 Forum Drive, Grand Prairie, Texas 75053-4005; telephone (972) 641-3460, fax (972) 641-3527. Copies may be inspected at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(f) This amendment becomes effective on July 12, 2000.

**Note 3:** The subject of this AD is addressed in Direction Generale De L'Aviation Civile (France) AD 92-185-33(B)R4, dated December 4, 1996.

Issued in Fort Worth, Texas, on May 26, 2000.

**Henry A. Armstrong,**

*Manager, Rotorcraft Directorate, Aircraft Certification Service.*

[FR Doc. 00-14193 Filed 6-6-00; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Airspace Docket No. 97-AWA-1]

**RIN 2120-AA66**

#### Modification of the San Francisco Class B Airspace Area; CA

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies the San Francisco, CA, Class B airspace area. Specifically, this action raises the airspace ceiling from 8,000 to 10,000 feet mean sea level (MSL); lowers the

airspace floor in a few areas; combines and reconfigures several existing areas; and creates some new areas. The FAA is taking this action to enhance safety, to reduce the potential for midair collision, and to improve the management of air traffic operations into, out of, and through the San Francisco Class B airspace area, while accommodating the concerns of airspace users.

**EFFECTIVE DATE:** 0901 UTC, September 7, 2000.

#### FOR FURTHER INFORMATION CONTACT:

Joseph C. White, Airspace and Rules Division, ATA-400, Office of Air Traffic Airspace Management, Federal Aviation Administration, 800 Independence Avenue, SW., Washington, DC 20591; telephone: (202) 267-8783.

#### SUPPLEMENTARY INFORMATION:

##### Availability of Final Rule

An electronic copy of this document may be downloaded from the FAA regulations section of the Fedworld electronic bulletin board service (telephone: (703) 321-3339) or the **Federal Register's** electronic bulletin board service (telephone: (202) 512-1661) using a modem and suitable communications software.

Internet users may reach the FAA's web page at <http://www.faa.gov> or the **Federal Register's** web page at <http://www.access.gpo.gov/nara> for access to recently published rulemaking documents.

Any person may obtain a copy of this final rule by submitting a request to the Federal Aviation Administration, Office of Air Traffic Airspace Management, Attention: Airspace and Rules Division, ATA-400, 800 Independence Avenue, SW., Washington, DC 20591, or by calling (202) 267-8783.

Communications must identify the docket number of this final rule. Persons interested in being placed on a mailing list for future NPRM's or final rules should contact the Federal Aviation Administration, Office of Rulemaking, (202) 267-9677, to request a copy of Advisory Circular No. 11-2A, Notice of Proposed Rulemaking Distribution System, which describes the application procedure.

##### Related Rulemaking Actions

On May 21, 1970, the FAA published the Designation of Federal Airways, Controlled Airspace, and Reporting Points Final Rule in the **Federal Register** (35 FR 7782). This rule provided for the establishment of Terminal Control Airspace (TCA) areas (now known as Class B airspace areas).

On June 21, 1988, the FAA published the Transponder With Automatic

Altitude Reporting Capability Requirement Final Rule in the **Federal Register** (53 FR 23356). This rule requires all aircraft to have an altitude encoding transponder when operating within 30 nautical miles (NM) of any designated Class B airspace area primary airport from the surface up to 10,000 feet MSL. This rule excluded those aircraft that were not originally certificated with an engine-driven electrical system (or those that have not subsequently been certified with such a system), balloons, or gliders operating outside of the Class B airspace area, but within 30 NM of the primary airport.

On October 14, 1988, the FAA published the Terminal Control Area Classification and Terminal Control Area Pilot and Navigation Equipment Requirements Final Rule in the **Federal Register** (53 FR 40318). This rule, in part, requires the pilot-in-command of a civil aircraft operating within a Class B airspace area to hold at least a private pilot certificate, except for a student pilot who has received certain documented training.

On December 17, 1991, the FAA published the Airspace Reclassification Final Rule in the **Federal Register** (56 FR 65638). This rule discontinued the use of the term "Terminal Control Area" and replaced it with the designation "Class B airspace area." This change in terminology is reflected in this final rule.

##### Background

The Class B airspace area program was developed to reduce the potential for midair collision in the congested airspace surrounding airports with high density air traffic operations by providing an area wherein all aircraft are subject to certain operating rules and equipment requirements.

The density of traffic and the type of operations being conducted in the airspace surrounding major terminals increase the probability of midair collisions. In 1970, an extensive study found that the majority of midair collisions occurred between a general aviation (GA) aircraft and an air carrier or military aircraft, or another GA aircraft. The basic causal factor common to these conflicts was the mix of aircraft operating under visual flight rules (VFR) and aircraft operating under instrument flight rules (IFR). Class B airspace areas provide a method to accommodate the increasing number of IFR and VFR operations. The regulatory requirements of these airspace areas afford the greatest protection for the greatest number of people by giving air traffic control (ATC) the increased capability to provide aircraft separation service,