

# Rules and Regulations

Federal Register

Vol. 68, No. 165

Tuesday, August 26, 2003

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents. Prices of new books are listed in the first FEDERAL REGISTER issue of each week.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-SW-04-AD; Amendment 39-13264; AD 2003-16-11]

RIN 2120-AA64

#### Airworthiness Directives; MD Helicopters, Inc., Model 600N Helicopters

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD) for the specified MD Helicopters, Inc. (MDHI) model helicopters that requires reducing the life limit of the main rotor drive shaft (drive shaft) and changing the life limit on the component history card or equivalent record. This amendment is prompted by the review of final fatigue test data, which indicates that the life limit of the drive shaft should be reduced by 2000 hours time-in-service (TIS). The actions specified by this AD are intended to prevent failure of the drive shaft, loss of drive of the main rotor system, and subsequent loss of control of the helicopter.

**DATES:** Effective September 30, 2003.

**FOR FURTHER INFORMATION CONTACT:** Chinh Vuong, Aviation Safety Engineer, FAA, Los Angeles Aircraft Certification Office, Propulsion Branch, 3960 Paramount Blvd., Lakewood, California 90712, telephone (562) 627-5264, fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:** A proposal to amend 14 CFR part 39 to include an AD for the specified model helicopters was published in the **Federal Register** on May 19, 2003 (68 FR 27006). That action proposed reducing the life limit of the drive shaft from 16,000 hours TIS to 14,000 hours

TIS and revising the component history card or an equivalent record to reflect the reduced life limit.

MDHI has issued Service Bulletin SB600N-033, dated December 13, 2001, which specifies reducing the life limit of the drive shaft at the next scheduled maintenance or within 1 year, whichever occurs first.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposal or the FAA's determination of the cost to the public. The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

On July 10, 2002, the FAA issued a new version of 14 CFR part 39 (67 FR 47997, July 22, 2002), which governs the FAA's AD system. The regulation now includes material that relates to altered products, special flight permits, and alternative methods of compliance. However, for clarity and consistency in this final rule, we have retained the language of the NPRM regarding that material.

The FAA estimates that this AD will affect 46 helicopters of U.S. registry, and it will take approximately .5 work hour per helicopter to update the records at an average labor rate of \$65 per work hour. Based on these figures, we estimate the total cost impact of the AD on U.S. operators to be \$1,495.

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules

Docket at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. Section 39.13 is amended by adding a new airworthiness directive to read as follows:

#### 2003-16-11 MD Helicopters, Inc.:

Amendment 39-13264. Docket No. 2003-SW-04-AD.

**Applicability:** Model 600N, with main rotor drive shaft assembly (drive shaft), part number (P/N) 600N5510-1, installed, certificated in any category.

**Note 1:** This AD applies to each helicopter identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For helicopters that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required within 100 hours time-in-service (TIS), unless accomplished previously.

To prevent failure of the drive shaft, loss of drive to the main rotor hub, and subsequent loss of control of the helicopter, accomplish the following:

(a) Revise the component history card or equivalent record for drive shaft, P/N 600N5510-1, by changing the life limit from 16,000 to 14,000 hours TIS. Before further flight, replace any drive shaft that has 14,000 or more hours TIS with an airworthy drive shaft.

(b) This AD revises the Limitations section of the maintenance manual by reducing the life limit of the drive shaft, P/N 600N5510-1, to 14,000 hours TIS.

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (LAACO), FAA. Operators shall submit their requests through an FAA Principal Maintenance Inspector, who may concur or comment and then send it to the Manager, LAACO.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the LAACO.

(d) Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the helicopter to a location where the requirements of this AD can be accomplished.

(e) This amendment becomes effective on September 30, 2003.

Issued in Fort Worth, Texas, on August 5, 2003.

**David A. Downey,**

*Manager, Rotorcraft Directorate, Aircraft Certification Service.*

[FR Doc. 03-21521 Filed 8-25-03; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NE-10-AD; Amendment 39-13286; AD 2003-17-11]

**RIN 2120-AA64**

#### **Airworthiness Directives; Rolls-Royce Deutschland Ltd & Co KG Dart 528, 529, 529D, 531, 532, 535, 542, and 552 Series Turboprop Engines**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for Rolls-Royce Deutschland Ltd & Co KG (RRD) (formerly Rolls-Royce plc) Dart 528-7E, 529-7H, -7E, -8E, -8H, -8X, -8Y, -8Z, 529D-7E, -7H, -8E, -8H, -8X, -8Y, -8Z, 531, 532-2L, -7, -7N, -7P, -7L, -7R, 535-2, -7R, 542-4, -4K, -10, -10J, -10K, 552-2, 552-7, and -7R turboprop engines. This AD requires removal of any Sermetel coating (Omat 7/46) from certain high pressure (HP) turbine discs and intermediate pressure (IP) turbine discs, and inspection of discs after coating removal. This AD is prompted by reports of Sermetel coating (Omat 7/46) applied to certain turbine discs which, if allowed to remain on the discs

would react adversely with the disc dry film lubricant, and could result in uncontained HP or IP turbine disc failure, resulting in possible damage to the airplane. We are issuing this AD to prevent uncontained HP or IP turbine disc failure, which could result in damage to the airplane.

**DATES:** This AD becomes effective September 30, 2003.

**ADDRESSES:** You may get the service information identified in this AD from Rolls-Royce Deutschland Ltd & Co KG, Eschenweg 11, D-15827 Dahlewitz, Germany; Tel: 49-33-7086-1768; Fax: 49-33-7086-3356.

You may examine the AD docket at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA.

#### **FOR FURTHER INFORMATION CONTACT:**

James Lawrence, Aerospace Engineer, Engine Certification Office, FAA, Engine and Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803-5299; telephone (781) 238-7176; fax (781) 238-7199.

**SUPPLEMENTARY INFORMATION:** The FAA proposed to amend 14 CFR Part 39 with a proposed AD. The proposed AD applies to RRD (formerly Rolls-Royce plc) Dart 528-7E, 529-7H, -7E, -8E, -8H, -8X, -8Y, -8Z, 529D-7E, -7H, -8E, -8H, -8X, -8Y, -8Z, 531, 532-2L, -7, -7N, -7P, -7L, -7R, 535-2, -7R, 542-4, -4K, -10, -10J, -10K, 552-2, 552-7, and -7R turboprop engines. We published the proposed AD in the *Federal Register* on May 5, 2003 (68 FR 23620). That action proposed to require removal of any Sermetel coating (Omat 7/46) from certain HP turbine discs and IP turbine discs, and inspection of discs after coating removal.

#### **Comments**

We provided the public the opportunity to participate in the development of this AD. We received no comments on the proposal or on the determination of the cost to the public.

#### **Conclusion**

We have carefully reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.

#### **Changes to 14 CFR Part 39—Effect on the AD**

On July 10, 2002, the FAA published a new version of 14 CFR part 39 (67 FR 47997, July 22, 2002), which governs the FAA's AD system. That regulation now includes material that relates to altered products, special flight permits, and alternative methods of compliance. The material previously was included in

each individual AD. Since the material is included in 14 CFR part 39, we will not include it in future AD actions.

#### **Regulatory Findings**

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a summary of the costs to comply with this AD and placed it in the AD Docket. You may get a copy of this summary by sending a request to us at the address listed under **ADDRESSES**. Include "AD Docket No. 2003-NE-10-AD" in your request.

#### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Safety.

#### **Adoption of the Amendment**

■ Accordingly, under the authority delegated to me by the Administrator, the Federal Aviation Administration amends 14 CFR part 39 as follows:

#### **PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### **§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2003-17-11 Rolls-Royce Deutschland Ltd & Co KG:** Amendment 39-13286. Docket No. 2003-NE-10-AD.

#### **Effective Date**

(a) This AD becomes effective September 30, 2003.

#### **Affected ADs**

(b) None.

#### **Applicability**

(c) This AD applies to Rolls-Royce Deutschland Ltd & Co KG (RRD) (formerly Rolls-Royce plc) Dart 528-7E, 529-7H, -7E,