

Issued in Renton, Washington, on March 14, 2011.

Ali Bahrami,

Manager, Transport Airplane Directorate,
Aircraft Certification Service.

[FR Doc. 2011-6643 Filed 3-21-11; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2011-0255; Directorate Identifier 2010-NM-253-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A310 Series Airplanes, and Airbus Model A300 B4-600, B4-600R, and F4-600R Series Airplanes, and Model C4-605R Variant F Airplanes (Collectively Called A300-600 Series Airplanes)

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

An operator reported several cases of wire damages at the pylon/wing interface. Analysis revealed that wires damages are due to installation quality issue resulting from lack of information in installation drawings and job cards.

Moreover detailed analysis has highlighted that the Low Pressure Valve (LPV) wires were not segregated by design.

* * * * *

If left uncorrected, the wire chafing could impact fire protection and detection system. It may also induce dormant failure on LPV preventing its closure leading to a permanent and uncontrolled fire (in case of fire ignited upstream the High Pressure Valve (HPV)).

* * * * *

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by May 6, 2011.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS—EAW (Airworthiness Office), 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; e-mail account.airworth-eas@airbus.com; Internet <http://www.airbus.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2125; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2011-0255; Directorate Identifier 2010-NM-253-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to [http://](http://www.regulations.gov)

www.regulations.gov, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2010-0178, dated August 23, 2010 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

An operator reported several cases of wire damages at the pylon/wing interface. Analysis revealed that wires damages are due to installation quality issue resulting from lack of information in installation drawings and job cards.

Moreover detailed analysis has highlighted that the Low Pressure Valve (LPV) wires were not segregated by design.

Due to design similarities, A310, A300-600 and A300-600ST aeroplanes can be affected, depending on the wires installation in the concerned area.

If left uncorrected, the wire chafing could impact fire protection and detection system. It may also induce dormant failure on LPV preventing its closure leading to a permanent and uncontrolled fire (in case of fire ignited upstream the High Pressure Valve (HPV)).

For the reasons explained above, this AD requires the modification of the electrical installation in the pylon/wing interface to avoid wire damages.

The modification includes a general visual inspection of wires for damage, and repair if necessary. You may obtain further information by examining the MCAI in the AD docket.

Relevant Service Information

Airbus has issued Mandatory Service Bulletin A300-24-6106, including Appendix 01, dated March 31, 2010; and Mandatory Service Bulletin A310-24-2106, including Appendix 01, dated May 27, 2010. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or

develop on other products of the same type design.

Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 185 products of U.S. registry. We also estimate that it would take about 16 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$1,170 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these costs. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$468,050, or \$2,530 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

Airbus: Docket No. FAA-2011-0255; Directorate Identifier 2010-NM-253-AD.

Comments Due Date

(a) We must receive comments by May 6, 2011.

Affected ADs

(b) None.

Applicability

(c) This AD applies to Airbus Model A300 B4-601, B4-603, B4-620, and B4-622 airplanes; Model A300 B4-605R and B4-622R airplanes; Model A300 F4-605R and F4-622R airplanes; Model A300 C4-605R Variant F airplanes; Airbus Model A310-203, -204, -221, -222, -304, -322, -324, and -325 airplanes; certificated in any category.

Subject

(d) Air Transport Association (ATA) of America Code 24: Electrical Power.

Reason

(e) The mandatory continuing airworthiness information (MCAI) states: An operator reported several cases of wire damages at the pylon/wing interface. Analysis revealed that wires damages are due to installation quality issue resulting from lack of information in installation drawings and job cards.

Moreover detailed analysis has highlighted that the Low Pressure Valve (LPV) wires were not segregated by design.

* * * * *

If left uncorrected, the wire chafing could impact fire protection and detection system. It may also induce dormant failure on LPV preventing its closure leading to a permanent and uncontrolled fire (in case of fire ignited upstream the High Pressure Valve (HPV)).

* * * * *

Compliance

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

Actions

(g) Within 30 months or 4,000 flight hours after the effective date of this AD, whichever occurs first: Modify the electrical installation in the pylon/wing interface on the left-hand and right-hand side by doing a general visual inspection of wires for damage and doing all applicable repairs, replace the cable tie with lacing tape, improve the electrical installation at the level of the electrical ramp, and improve the segregation of both routes of the LPV channels 1 and 2 between LPV connector and ramp; in accordance with the Accomplishment Instructions of Airbus Mandatory Service Bulletin A300-24-6106, dated March 31, 2010 (for Airbus Model A300 B4-600, B4-600R, and F4-600R series airplanes, and Model C4-605R Variant F airplanes); or Airbus Mandatory Service Bulletin A310-24-2106, dated May 27, 2010 (for Airbus Model A310 series airplanes). Do all applicable repairs before further flight.

FAA AD Differences

Note 1: This AD differs from the MCAI and/or service information as follows: No differences.

Other FAA AD Provisions

(h) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2125; fax (425) 227-1149. Information may be e-mailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov.

Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

Related Information

(i) Refer to MCAI European Aviation Safety Agency Airworthiness Directive 2010-0178, dated August 23, 2010; Airbus Mandatory Service Bulletin A300-24-6106, dated March 31, 2010; and Airbus Mandatory Service Bulletin A310-24-2106, dated May 27, 2010; for related information.

Issued in Renton, Washington, on March 14, 2011.

Ali Bahrami,

Manager, Transport Airplane Directorate,
Airframe Certification Service.

[FR Doc. 2011-6614 Filed 3-21-11; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2011-0225; Directorate Identifier 2010-NM-211-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A330-200 and -300 Series Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

* * * * *

The airworthiness limitations applicable to the Safe Life Airworthiness Limitation Items (SL ALI) are given in Airbus A330 ALS Part 1 and A340 ALS Part 1, which are approved by the European Aviation Safety Agency (EASA).

The revision 05 of Airbus A340 ALS Part 1 introduces more restrictive maintenance requirements and/or airworthiness

limitations. Failure to comply with this revision constitutes an unsafe condition.

For A330 aeroplanes, this EASA AD retains the requirements of EASA AD 2010-0131, which it supersedes.

For A340 aeroplanes, this EASA AD supersedes EASA AD 2009-0192, and requires the implementation of the new or more restrictive maintenance requirements and/or airworthiness limitations as specified in Airbus A340 ALS Part 1, revision 05.

The unsafe condition is fatigue cracking, damage, and corrosion in certain structure, which could result in reduced structural integrity of the airplane. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by May 6, 2011.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax*: (202) 493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS—Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80, e-mail airworthiness.A330-A340@airbus.com; Internet <http://www.airbus.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1138; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2011-0225; Directorate Identifier 2010-NM-211-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2010-0253, dated December 3, 2010 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

The airworthiness limitations are currently distributed in the Airbus A330 Airworthiness Limitations Section (ALS) and A340 ALS.

The airworthiness limitations applicable to the Safe Life Airworthiness Limitation Items (SL ALI) are given in Airbus A330 ALS Part 1 and A340 ALS Part 1, which are approved by the European Aviation Safety Agency (EASA).

The revision 05 of Airbus A340 ALS Part 1 introduces more restrictive maintenance requirements and/or airworthiness limitations. Failure to comply with this revision constitutes an unsafe condition.

For A330 aeroplanes, this EASA AD retains the requirements of EASA AD 2010-0131, which it supersedes.

For A340 aeroplanes, this EASA AD supersedes EASA AD 2009-0192, and requires the implementation of the new or more restrictive maintenance requirements and/or airworthiness limitations as specified in Airbus A340 ALS Part 1, revision 05.

The unsafe condition is fatigue cracking, damage, and corrosion in certain structure, which could result in reduced structural integrity of the airplane. You