

Proposed Rules

Federal Register

Vol. 77, No. 116

Friday, June 15, 2012

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2012-0634; Directorate Identifier 2012-CE-016-AD]

RIN 2120-AA64

Airworthiness Directives; PIAGGIO AERO INDUSTRIES S.p.A Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for PIAGGIO AERO INDUSTRIES S.p.A. Model P-180 airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as jamming of the external bearing of the screwjack drive gear, which resulted in failure of the main wing outboard flap external actuator. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by July 30, 2012.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590,

between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Piaggio Aero Industries S.p.A.—Airworthiness Office, Via Luigi Cibrario, 4—16154 Genova-Italy; phone: +39 010 6481353; fax: +39 010 6481881; email: airworthiness@piaggioaero.it; Internet: <http://www.piaggioaero.com/#/en/after-sales/service-support>. You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: mike.kiesov@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2012-0634; Directorate Identifier 2012-CE-016-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA AD No.: 2012-0066, dated April 24, 2012 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

Failures of the Main Wing Outboard Flap external actuator have been reported by P.180 operators.

The investigation revealed that due to jamming of the external bearing, the screwjack drive gear disengaged from its seat and the external actuator stopped, while the inner one continued its run.

This condition, if not corrected, could lead to an asymmetrical flap actuators operation and cause an interference between the flap and adjacent aileron, possibly resulting in reduced control of the aeroplane.

For the reasons described above, this AD requires the installation of a covering cage on the screwjack, as a temporary corrective action, which does not allow the disengagement of the affected gear.

You may obtain further information by examining the MCAI in the AD docket.

Relevant Service Information

PIAGGIO AERO INDUSTRIES S.p.A. has issued Service Bulletin No. 80-0318, dated October 24, 2011; Service Bulletin No. 80-0318, revision 1, dated February 3, 2012; and Service Bulletin No. 80-0318, revision 2, dated March 28, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA’s Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Costs of Compliance

We estimate that this proposed AD will affect 110 products of U.S. registry. We also estimate that it would take about 6 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$2,770 per product.

Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$360,800, or \$3,280 per product.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

PIAGGIO AERO INDUSTRIES S.p.A: Docket No. FAA-2012-0634; Directorate Identifier 2012-CE-016-AD.

(a) Comments Due Date

We must receive comments by July 30, 2012.

(b) Affected ADs

None.

(c) Applicability

This AD applies to PIAGGIO AERO INDUSTRIES S.p.A Model P-180 airplanes, serial numbers (S/Ns) 1002 and 1004 through 1223, certificated in any category.

(d) Subject

Air Transport Association of America (ATA) Code 27: Flight Controls.

(e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

(f) Actions and Compliance

Unless already done, before the effective date of this AD, following the Accomplishment Instructions of Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012, do the following actions:

- (1) *For S/Ns 1002 and 1004 through 1135:*
- (i) *For aircraft with less than 1,500 hours total time-in-service (TIS) at the effective date of this AD:* Within 1,500 hours TIS after the effective date of this AD or within 12 calendar months after the effective date of this AD, whichever occurs first, install covering cages on both left and right wing outboard flap external screwjacks. Follow the

Accomplishment Instructions of Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012.

(ii) *For aircraft with 1,500 hours total TIS but less than 2,800 hours total TIS at the effective date of this AD:* Upon or before reaching a total of 3,000 hours TIS after the effective date of this AD or within 12 calendar months after the effective date of this AD, whichever occurs first, install covering cages on both left and right wing outboard flap external screwjacks. Follow the Accomplishment Instructions of Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012.

(iii) *For aircraft with 2,800 hours total TIS or more at the effective date of this AD:* Within 200 hours TIS after the effective date of this AD or within 12 calendar months after the effective date of this AD, whichever occurs first, install covering cages on both left and right wing outboard flap external screwjacks. Follow the Accomplishment Instructions of Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012.

(2) *For S/Ns 1136 through 1223 (inclusive):* Within 1,500 hours TIS after the effective date of this AD or within 12 calendar months after the effective date of this AD, whichever occurs first, install covering cages on both left and right wing outboard flap external screwjacks. Follow the Accomplishment Instructions of Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012.

Note to paragraph (f) of this AD: S/Ns 1224 and subsequent have covering cages on both left and right wing outboard flap external screwjacks installed during production.

(g) Credit for Actions Accomplished in Accordance With Previous Service Information

This AD provides credit for the actions required in this AD if already done before the effective date of this AD following Service Bulletin No. 80-0318, dated October 24, 2011; Service Bulletin No. 80-0318, revision 1, dated February 3, 2012; and Service Bulletin No. 80-0318, revision 2, dated March 28, 2012.

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: mike.kiesov@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these

actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, a federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

(i) Related Information

Refer to MCAI European Aviation Safety Agency (EASA) AD No.: 2012-0066, dated April 24, 2012; Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, dated October 24, 2011; Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 1, dated February 3, 2012; and Piaggio Aero Industries S.p.A. Mandatory Service Bulletin No. 80-0318, revision 2, dated March 28, 2012, for related information. For service information related to this AD, contact Piaggio Aero Industries S.p.A.—Airworthiness Office, Via Luigi Cibrario, 4-16154 Genova-Italy; phone: +39 010 6481353; fax: +39 010 6481881; email: airworthiness@piaggioaero.it; Internet: <http://www.piaggioaero.com/#/en/aftersales/service-support>. You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on May 11, 2012.

John Colomy,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012-14723 Filed 6-14-12; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2012-0633; Directorate Identifier 2012-CE-018-AD]

RIN 2120-AA64

Airworthiness Directives; Diamond Aircraft Industries GmbH Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Diamond Aircraft Industries GmbH Models DA 42, DA 42 NG, and DA 42 M-NG airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as excessive voids in the adhesive joint between the center wing spars and the upper center wing skins. This condition could cause the wing to fail, which could result in loss of control of the airplane. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by July 30, 2012.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Diamond Aircraft Industries GmbH, N.A. Otto-Straße 5, A-2700 Wiener Neustadt, Austria, telephone: +43 2622 26700; fax: +43 2622 26780; email: office@diamond-air.at; Internet: <http://www.diamond-air.at>. You may review copies of the referenced service information at the FAA, Small Airplane Directorate,

901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: mike.kiesov@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2012-0633; Directorate Identifier 2012-CE-018-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued AD No. 2011-0100, dated May 26, 2011 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

During conversion of a DA 42 to a DA 42 NG, voids were detected in the adhesive joint between the centre wing spars and the upper centre wing skins, between the fuselage wall and the engine nacelle. The available information indicates that wings with voids continue to meet the certification design