

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Repetitive Inspections and Corrective Actions**

Within 1,250 flight hours after the effective date of this AD: Perform a detailed inspection for cracks of the radome assembly, in accordance with the Accomplishment Instructions of Live TV Service Bulletin B737-53-0011, dated March 29, 2013. Repeat the inspection thereafter at intervals not to exceed 1,250 flight hours. If any crack is found during any inspection required by this paragraph, before further flight, replace the radome, in accordance with the Accomplishment Instructions of Live TV Service Bulletin B737-53-0011, dated March 29, 2013.

**(h) Reporting Requirement**

If any crack is found during any inspection required by paragraph (g) of this AD, submit a report of the findings to Live TV, 8900 Hangar Boulevard, Orlando, FL 32827; phone: 407-812-2600; fax: 407-812-2526; email [JaneAnne.Webb@livetv.net](mailto:JaneAnne.Webb@livetv.net); at the applicable time specified in paragraph (h)(1) or (h)(2) of this AD. The report must include the information specified in the service bulletin reporting form provided in Live TV Service Bulletin B737-53-0011, dated March 29, 2013.

(1) If the inspection was accomplished on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(2) If the inspection was accomplished before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

**(i) Special Flight Permit**

Special flight permits, as described in Section 21.197 and Section 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199), are not allowed.

**(j) Paperwork Reduction Act Burden Statement**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(k) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Atlanta Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (l) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) If the service information contains steps that are labeled as RC (Required for Compliance), those steps must be done to comply with this AD; any steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or done using accepted methods different from those identified in the specified service information without obtaining approval of an AMOC, provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC require approval of an AMOC.

**(l) Related Information**

For more information about this AD, contact Barry Culler, Aerospace Engineer, Airframe Branch, ACE-117A, FAA, Atlanta Aircraft Certification Office (ACO), 1701 Columbia Avenue, College Park, GA 30337; phone: 404-474-5546; fax: 404-474-5605; email: [william.culler@faa.gov](mailto:william.culler@faa.gov).

**(m) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Live TV Service Bulletin B737-53-0011, dated March 29, 2013.

(ii) Reserved.

(3) For service information identified in this AD, contact Live TV, 8900 Hangar Boulevard, Orlando, FL 32827; phone: 407-812-2600; fax: 407-812-2526; Internet <http://www.livetv.net>.

(4) You may view this service information at FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 5, 2014.

**Jeffrey E. Duven,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014-03033 Filed 2-24-14; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2013-0924; Directorate Identifier 2013-CE-032-AD; Amendment 39-17755; AD 2014-03-18]**

**RIN 2120-AA64**

**Airworthiness Directives; B-N Group Ltd. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for B-N Group Ltd. Models BN-2, BN-2A, BN-2A-2, BN-2A-3, BN-2A-6, BN-2A-8, BN-2A-9, BN-2A-20, BN-2A-21, BN-2A-26, BN-2A-27, BN-2B-20, BN-2B-21, BN-2B-26, BN-2B-27, BN2A MK. III, BN2A MK. III-2, and BN2A MK. III-3 airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as damage of the cable sliding end assembly and installation of the incorrect end fitting on engine control cable assemblies. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective April 1, 2014.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of April 1, 2014.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2013-0924; or in person at Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Britten-Norman Aircraft Limited, Commodore House,

Mountbatten Business Centre, Millbrook Road East, Southampton SO15 1HY, United Kingdom; telephone: +44 20 3371 4000; fax: +44 20 3371 4001; email: [info@bnaircraft.com](mailto:info@bnaircraft.com); Internet: <http://www.britten-norman.com/customer-support/>. You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

#### FOR FURTHER INFORMATION CONTACT:

Taylor Martin, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4138; fax: (816) 329-4090; email: [taylor.martin@faa.gov](mailto:taylor.martin@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to B-N Group Ltd. Models BN-2, BN-2A, BN-2A-2, BN-2A-3, BN-2A-6, BN-2A-8, BN-2A-9, BN-2A-20, BN-2A-21, BN-2A-26, BN-2A-27, BN-2B-20, BN-2B-21, BN-2B-26, BN-2B-27, BN2A MK. III, BN2A MK. III-2, and BN2A MK. III-3 airplanes. That NPRM was published in the **Federal Register** on October 30, 2013 (78 FR 64894). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

Britten-Norman Aircraft Limited has been made aware of two occurrences where a failure of engine control cable assemblies has caused engine control difficulties. In both reported cases, the cable sliding end assemblies were in poor condition and in both cases, an incorrect end-fitting was installed which may have contributed to the failures.

This condition, if not detected and corrected, could result in reduced engine control, possibly resulting in reduced control of the aeroplane.

To address this potential unsafe condition, Britten-Norman Aircraft have issued Service Bulletin (SB) 334 to provide inspection instructions.

For the reason described above, this AD requires a one-time inspection and functional test of the engine control cables and, depending on findings, replacement of the cables.

The MCAI can be found in the AD docket on the Internet at: <http://www.regulations.gov/#/documentDetail;D=FAA-2013-0924-0002>.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (78

FR 64894, October 30, 2013) or on the determination of the cost to the public.

#### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (78 FR 64894, October 30, 2013) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (78 FR 64894, October 30, 2013).

#### Costs of Compliance

We estimate that this AD will affect 101 products of U.S. registry. We also estimate that it will take about 1 work-hour per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the AD on U.S. operators to be \$8,585, or \$85 per product.

In addition, we estimate that any necessary follow-on actions will take about 10 work-hours and require parts costing \$4,800 (4 per airplane), for a cost of \$5,650 per product. We have no way of determining the number of products that may need these actions.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States,

or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2013-0924; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2014-03-18 B-N Group Ltd.:** Amendment 39-17755; Docket No. FAA-2013-0924; Directorate Identifier 2013-CE-032-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective April 1, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to B-N Group Ltd. Models BN-2, BN-2A, BN-2A-2, BN-2A-3, BN-2A-

6, BN-2A-8, BN-2A-9, BN-2A-20, BN-2A-21, BN-2A-26, BN-2A-27, BN-2B-20, BN-2B-21, BN-2B-26, BN-2B-27, BN2A MK. III, BN2A MK. III-2, and BN2A MK. III-3 airplanes, all serial numbers, certificated in any category.

**(d) Subject**

Air Transport Association of America (ATA) Code 76: Engine Controls.

**(e) Reason**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as damage of the cable sliding end assembly and installation of the incorrect end fitting on engine control cable assemblies. We are issuing this AD to detect and correct damage of the cable sliding end assembly (cracking, distortion, corrosion) and incorrect end fittings on the engine control assemblies, which could lead to reduced engine control with consequent loss of control.

**(f) Actions and Compliance**

Unless already done, do the following actions in paragraphs (f)(1) through (f)(4) of this AD:

(1) Within the next 6 months after April 1, 2014 (the effective date of this AD), do a one-time inspection of the engine control cable assemblies, part number (P/N) 137835, P/N 172449-1, P/N 17250, and P/N 172451, and surrounding areas for damage (cracking, distortion, corrosion) and correct cable end-fitting and to assure the wire locking is intact following Britten-Norman Aircraft Limited Service Bulletin No. SB 334, Issue 1, dated August 30, 2013.

(2) If no discrepancies are found during the inspection required in paragraph (f)(1) of this AD, inspect the control linkages for proper adjustment and, before further flight, make any necessary changes following Britten-Norman Aircraft Limited Service Bulletin No. SB 334, Issue 1, dated August 30, 2013.

(3) If any discrepancies are found during the inspection required in paragraph (f)(1) of this AD and/or the control linkages cannot be properly adjusted as specified in paragraph (f)(2) of this AD, before further flight, replace the engine control cable assembly with a serviceable unit following Britten-Norman Aircraft Limited Service Bulletin No. SB 334, Issue 1, dated August 30, 2013.

(4) After April 1, 2014 (the effective date of this AD), do not install on any airplane engine control cable assemblies, part number (P/N) 137835, P/N 172449-1, P/N 17250, and P/N 172451, unless they are new or have been inspected as required in paragraphs (f)(1) and (f)(2) of this AD and found free of any discrepancies and have proper adjustment.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to

ATTN: Taylor Martin, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4138; fax: (816) 329-4090; email: [taylor.martin@faa.gov](mailto:taylor.martin@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(h) Related Information**

Refer to MCAI European Aviation Safety Agency (EASA) AD No.: 2013-0215, dated September 16, 2013, for related information. You may examine the MCAI in the AD docket on the Internet at: <http://www.regulations.gov/#!documentDetail;D=FAA-2013-0924-0002>.

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Britten-Norman Aircraft Limited Service Bulletin No. SB 334, Issue 1, dated August 30, 2013.

(ii) Reserved.

(3) For service information identified in this AD, contact Britten-Norman Aircraft Limited, Commodore House, Mountbatten Business Centre, Millbrook Road East, Southampton SO15 1HY, United Kingdom; telephone: +44 20 3371 4000; fax: +44 20 3371 4001; email: [info@bnaircraft.com](mailto:info@bnaircraft.com); Internet: <http://www.britten-norman.com/customer-support/>.

(4) You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on February 6, 2014.

**Earl Lawrence,**

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-03242 Filed 2-24-14; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2013-0997; Directorate Identifier 2013-CE-044-AD; Amendment 39-17759; AD 2014-04-01]

RIN 2120-AA64

**Airworthiness Directives; Slingsby Aviation Ltd. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Slingsby Aviation Ltd. Model T67M260 airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as cracked horizontal stabilizer attachment brackets. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective April 1, 2014.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of April 1, 2014.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2013-0997>; or in person at Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Slingsby Advanced Composites, Ings Lane, Kirbymoorside, York, YO62 6EZ, United Kingdom, telephone: +44 (0) 1751 432474; fax +44 (0) 1751 433016, Internet: [www.marshall-slingsby.com](http://www.marshall-slingsby.com). You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

**FOR FURTHER INFORMATION CONTACT:**

Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

**SUPPLEMENTARY INFORMATION:**