

Bulletin ISB.32–186, dated April 12, 2012, unless in compliance with the requirements of this AD.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Todd Thompson, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1175; fax 425–227–1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or BAE Systems (Operations) Limited's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (k) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) Airworthiness Directive 2012–0191R1, dated November 6, 2012, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/>#!documentDetail;D=FAA-2013-1026-0002.

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) BAE Systems (Operations) Limited Inspection Service Bulletin ISB.32–186, dated April 12, 2012.

(ii) Subject 05–10–15, Aircraft Equipment Airworthiness Limitations, of Section 05–10, Time Limits, of Chapter 05, Time Limits/Maintenance Checks, of the BAE Systems BAe 146 Series/AVRO 146–RJ Series Aircraft Maintenance Manual, Revision 108, dated September 15, 2012. The revision level and date of this document are identified on only page 1 of the Letter of Transmittal.

(3) For service information identified in this AD, contact BAE Systems (Operations) Limited, Customer Information Department, Prestwick International Airport, Ayrshire, KA9 2RW, Scotland, United Kingdom; telephone +44 1292 675207; fax +44 1292 675704; email [RAPublications@baesystems.com](mailto:RAPublications@baesystems.com); Internet <http://www.baesystems.com/Businesses/RegionalAircraft/index.htm>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 4, 2014.

**Jeffrey E. Duven,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014–19262 Filed 8–27–14; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA–2014–0588; Directorate Identifier 2014–NM–150–AD; Amendment 39–17963; AD 2014–17–10]**

**RIN 2120–AA64**

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Airbus Model A318, A319, A320, and A321 series airplanes. This AD requires repetitive on-ground power cycles (resets) of the Transponder, Terrain and Traffic Collision Avoidance System (T3CAS). This AD was prompted by reports of spurious terrain ahead warning system (TAWS) alerts during approach and takeoff. We are issuing this AD to prevent spurious TAWS alerts, which could increase flightcrew workload during critical landing or takeoff phases, and result in reduced control of the airplane.

**DATES:** This AD becomes effective September 12, 2014.

The Director of the Federal Register approved the incorporation by reference

of a certain publication listed in this AD as of September 12, 2014.

We must receive comments on this AD by October 14, 2014.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: 202–493–2251.
- Mail: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- Hand Delivery: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworthiness@airbus.com](mailto:account.airworthiness@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0588; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1405; fax 425–227–1149.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European

Community, has issued EASA Airworthiness Directive 2014–0174, dated July 23, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition on all Airbus Model A318, A319, A320, and A321 series airplanes. The MCAI states:

Following two cases of spurious Terrain Ahead Warning System (TAWS) alert during approach and take off in Geneva, the concerned Transponder, Terrain and Traffic Collision Avoidance System (T3CAS) was sent to ACSS, the manufacturer of the affected equipment, for investigation. The results of a laboratory investigation indicated that an internal frozen position anomaly occurs when T3CAS is constantly powered for more than 149 hours. The origin for this defect was identified as a counter limitation, which is identified as a purely T3CAS software misbehavior and is not self-detected. Only T3CAS units having Part Number (P/N) 9005000–10000 (software Standard 1.0), P/N 9005000–10101 (Standard 1.1), and P/N 9005000–10202 (Standard 1.2) are affected by this software error.

This condition, if not corrected, could lead to spurious TAWS alerts which could increase flight crew workload during critical landing or take off phases, possibly resulting in reduced control of the aeroplane.

Prompted by these reports, Airbus issued Alert Operators Transmission (AOT) A34N004–13 to provide instructions to reset the T3CAS.

For the reasons described above, this [EASA] AD requires repetitive on ground power cycles (resets) of the T3CAS unit.

You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0588.

#### Relevant Service Information

Airbus has issued Alert Operators Transmission A34N004–13, Revision 01, dated March 19, 2014. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA’s Determination and Requirements of This AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of these same type designs.

#### Differences Between This AD and the MCAI or Service Information

The MCAI requires revising the airplane maintenance program to incorporate the T3CAS on-ground power cycle instructions. EASA did not provide adequate details for this maintenance program revision; this requirement is therefore not included in this FAA AD.

The MCAI specifies a provision for installing a version (part number) of a T3CAS that is approved after the effective date of the EASA AD as a terminating action for the repetitive on-ground power cycles. Although this FAA AD does not include that provision, any person may request approval of an alternative method of compliance (AMOC) under the provisions of paragraph (j)(1) of this AD.

#### “Contacting the Manufacturer” Paragraph in This AD

Since late 2006, we have included a standard paragraph titled “Airworthy Product” in all MCAI ADs in which the FAA develops an AD based on a foreign authority’s AD.

The MCAI or referenced service information in an FAA AD often directs the owner/operator to contact the manufacturer for corrective actions, such as a repair. Briefly, the Airworthy Product paragraph allowed owners/operators to use corrective actions provided by the manufacturer if those actions were FAA-approved. In addition, the paragraph stated that any actions approved by the State of Design Authority (or its delegated agent) are considered to be FAA-approved.

In an NPRM having Directorate Identifier 2012–NM–101–AD (78 FR 78285, December 26, 2013), we proposed to prevent the use of repairs that were not specifically developed to correct the unsafe condition, by requiring that the repair approval provided by the State of Design Authority or its delegated agent specifically refer to the FAA AD. This change was intended to clarify the method of compliance and to provide operators with better visibility of repairs that are specifically developed and approved to correct the unsafe condition. In addition, we proposed to change the phrase “its delegated agent” to include a design approval holder (DAH) with State of Design Authority design organization approval (DOA), as applicable, to refer to a DAH authorized to approve required repairs for the proposed AD.

One commenter to the NPRM having Directorate Identifier 2012–NM–101–AD (78 FR 78285, December 26, 2013) stated

the following: “The proposed wording, being specific to repairs, eliminates the interpretation that Airbus messages are acceptable for approving minor deviations (corrective actions) needed during accomplishment of an AD mandated Airbus service bulletin.”

This comment has made the FAA aware that some operators have misunderstood or misinterpreted the Airworthy Product paragraph to allow the owner/operator to use messages provided by the manufacturer as approval of deviations during the accomplishment of an AD-mandated action. The Airworthy Product paragraph does not approve messages or other information provided by the manufacturer for deviations to the requirements of the AD-mandated actions. The Airworthy Product paragraph only addresses the requirement to contact the manufacturer for corrective actions for the identified unsafe condition and does not cover deviations from other AD requirements. However, deviations to AD-required actions are addressed in 14 CFR 39.17, and anyone may request the approval for an alternative method of compliance to the AD-required actions using the procedures found in 14 CFR 39.19.

To address this misunderstanding and misinterpretation of the Airworthy Product paragraph, we have changed the paragraph and retitled it “Contacting the Manufacturer.” This paragraph now clarifies that for any requirement in this AD to obtain corrective actions from a manufacturer, the actions must be accomplished using a method approved by the FAA, the European Aviation Safety Agency (EASA), or Airbus’s EASA DOA.

The Contacting the Manufacturer paragraph also clarifies that, if approved by the DOA, the approval must include the DOA-authorized signature. The DOA signature indicates that the data and information contained in the document are EASA-approved, which is also FAA-approved. Messages and other information provided by the manufacturer that do not contain the DOA-authorized signature approval are not EASA-approved, unless EASA directly approves the manufacturer’s message or other information.

This clarification does not remove flexibility previously afforded by the Airworthy Product paragraph. Consistent with long-standing FAA policy, such flexibility was never intended for required actions. This is also consistent with the recommendation of the Airworthiness Directive Implementation Aviation Rulemaking Committee to increase flexibility in complying with ADs by

identifying those actions in manufacturers' service instructions that are "Required for Compliance" with ADs. We continue to work with manufacturers to implement this recommendation. But once we determine that an action is required, any deviation from the requirement must be approved as an alternative method of compliance.

#### FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because spurious TAWS alerts could increase flightcrew workload during critical landing or take off phases, and result in reduced control of the airplane. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in fewer than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0588; Directorate Identifier 2014-NM-150-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Costs of Compliance

We estimate that this AD affects 855 airplanes of U.S. registry. We also estimate that it will take about 1 work-hour per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$0 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$72,675, or \$85 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2014-17-10 Airbus:** Amendment 39-17963. Docket No. FAA-2014-0588; Directorate Identifier 2014-NM-150-AD.

##### (a) Effective Date

This AD becomes effective September 12, 2014.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to all Airbus airplanes, certificated in any category, identified in paragraphs (c)(1) through (c)(4) of this AD.

(1) Model A318-111, -112, -121, and -122 airplanes.

(2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.

(3) Model A320-211, -212, -214, -231, -232, and -233 airplanes.

(4) Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

##### (d) Subject

Air Transport Association (ATA) of America Code 34, Navigation.

##### (e) Reason

This AD was prompted by reports of spurious terrain ahead warning system (TAWS) alerts during approach and takeoff. We are issuing this AD to prevent spurious TAWS alerts, which could increase flightcrew workload during critical landing or take off phases, and result in reduced control of the airplane.

##### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

##### (g) T3CAS On-Ground Power Cycle

For airplanes equipped with a Transponder, Terrain and Traffic Collision Avoidance System (T3CAS) unit having a part number and associated software standard identified in paragraph (g)(1), (g)(2), or (g)(3) of this AD: Within 30 days after the effective date of this AD, do an on-ground power cycle (reset) of the T3CAS, in accordance with the instructions of Airbus Alert Operators Transmission A34N004-13, Revision 01, dated March 19, 2014. Repeat the on-ground power cycle thereafter at intervals not to exceed 120 hours of continuous power of the T3CAS.

(1) Part number 9005000-10000 and software standard 1.0.

(2) Part number 9005000-10101 and software standard 1.1.

(3) Part number 9005000-10202 and software standard 1.2.

##### (h) Airplanes Excluded From Power-Cycle Requirements

Airplanes on which Airbus modification 39146, 152980, or 154341 has not been incorporated in production are not affected by the requirements of paragraph (g) of this AD, provided no T3CAS unit having a part

number and associated software standard identified in paragraph (g)(1), (g)(2), or (g)(3) of this AD is installed on that airplane.

#### (i) Parts Installation Limitation

As of the effective date of this AD, installation on an airplane of a T3CAS unit having a part number and software standard as identified in paragraph (g)(1), (g)(2), or (g)(3) of this AD is acceptable, provided the conditions specified in both paragraphs (i)(1) and (i)(2) of this AD are met.

(1) After installation of the T3CAS unit, the unit is repetitively power cycled as required by paragraph (g) of this AD.

(2) The T3CAS unit has accumulated less than 120 hours of continuous power.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (k) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0174, dated July 23, 2014, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0588.

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Alert Operators Transmission A34N004-13, Revision 01, dated March 19, 2014.

(ii) Reserved.

(3) For service information identified in this AD, contact Airbus, Airworthiness Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 19, 2014.

**Kevin Hull,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014-20474 Filed 8-27-14; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2014-0179; Directorate Identifier 2014-NE-03-AD; Amendment 39-17956; AD 2014-17-03]

RIN 2120-AA64

#### Airworthiness Directives; Technify Motors GmbH Reciprocating Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Technify Motors GmbH (type certificate previously held by Thielert Aircraft Engines GmbH) TAE 125-02-99 and TAE 125-02-114 reciprocating engines. This AD requires removal of each high-pressure (HP) fuel pump before 300 flight hours (FHs) in service or within 55 FHs after the effective date of the AD, whichever occurs later. This AD was prompted by in-flight shutdowns on airplanes with TAE 125-02 engines. We are issuing this AD to prevent failure of the HP fuel pump, which could result in damage to the engine and damage to the airplane.

**DATES:** This AD becomes effective October 2, 2014.

**ADDRESSES:** For service information identified in this AD, contact Technify Motors GmbH, Platanenstrasse 14, D-09356 Sankt Egidien, Germany, phone: +49-37204-696-0; fax: +49-37204-696-55; email: [info@centurion.aero](mailto:info@centurion.aero). You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0179; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the mandatory continuing airworthiness information (MCAI), the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

Kenneth Steeves, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7765; fax: 781-238-7199; email: [kenneth.steeves@faa.gov](mailto:kenneth.steeves@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to the specified products. The NPRM was published in the **Federal Register** on May 23, 2014 (79 FR 29693). The NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

In-flight shut down occurrences have been reported on aeroplanes equipped with TAE 125-02 engines. The initial results of the investigations showed that abnormal high wear of the high pressure fuel pumps was the probable cause of the engine failure.

This condition, if not corrected, could result in further cases of engine power loss events and consequent potential loss of control of the aeroplane.

##### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (79 FR 29693, May 23, 2014).