

**(i) Regulator Replacement**

Within 12 months after the effective date of this AD, unless already accomplished as specified in paragraph (h)(1) of this AD, replace each affected flightcrew oxygen mask regulator identified in paragraph (h) of this AD with a part identified in paragraph (i)(1) or (i)(2) of this AD. After replacement of all affected flightcrew oxygen mask regulators on an airplane, the actions specified in paragraph (h)(2) of this AD are no longer required, the AFM revision specified in paragraph (h)(2)(i) of this AD may be removed from the AFM, and the placard identified in paragraph (h)(2)(ii) of this AD may be removed from the airplane.

(1) A serviceable part, not having a part number and serial number listed in Appendix 1 of Zodiac Aerospace Service Bulletin MCF-SBU-35-001, Revision 1, dated December 3, 2012.

(2) A part that has been tested and passed the test in accordance with paragraph 3.A.(4) of the Accomplishment Instructions of Zodiac Aerospace Service Bulletin MCF-SBU-35-001, Revision 1, dated December 3, 2012.

**(j) Credit for Previous Actions**

This paragraph provides credit for actions required by paragraphs (g), (h)(1)(ii), and (i)(2) of this AD, if those actions were performed before the effective date of this AD using Zodiac Aerospace Service Bulletin MCF-SBU-35-001, dated October 25, 2012, which is not incorporated by reference in this AD.

**(k) Parts Installation Limitation**

As of the effective date of this AD, no person may install any flightcrew oxygen mask regulator with a part number and serial number listed in Appendix 1 of Zodiac Aerospace Service Bulletin MCF-SBU-35-001, Revision 1, dated December 3, 2012, on any airplane, unless the regulator has been tested and passed the test, in accordance with paragraph 3.A.(4) of the Accomplishment Instructions of Zodiac Aerospace Service Bulletin MCF-SBU-35-001, Revision 1, dated December 3, 2012.

**(l) Alternative Methods of Compliance (AMOCs)**

The Manager, Boston Aircraft Certification Office (ACO), ANE-150, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Ian Lucas, Aerospace Engineer, Boston Aircraft Certification Office, ANE-150, FAA, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7757; fax: 781-238-7170; email: [ian.lucas@faa.gov](mailto:ian.lucas@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

**(m) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2012-0254R1, dated December 21, 2012, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/#/documentDetail;D=FAA-2015-0927-0004>.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (n)(3) and (n)(4) of this AD.

**(n) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Zodiac Aerospace Service Bulletin MCF-SBU-35-001, Revision 1, dated December 3, 2012.

(ii) Reserved.

(3) For service information identified in this AD, contact Zodiac Services, Technical Publication Department, Zodiac Aerotechnics, Oxygen Systems Europe, 61 Rue Pierre Curie—CS20001, 78373 Plaisir Cedex, France; phone: (33) 01 61 24 23 23; fax: (33) 01 30 55 71 61; email: [yann.laine@zodiacaeospace.com](mailto:yann.laine@zodiacaeospace.com); Internet: <http://www.zodiacaeospace.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on November 3, 2015.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-28883 Filed 11-19-15; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2015-0932; Directorate Identifier 2014-NM-205-AD; Amendment 39-18326; AD 2015-23-10]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain The Boeing Company Model 747-8 series airplanes. This AD was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. This AD requires installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. We are issuing this AD to prevent detachment of the quick-release pin, which could result in separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

**DATES:** This AD is effective December 28, 2015.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of December 28, 2015.

**ADDRESSES:** For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0932.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0932; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:**  
Stanley Chen, Aerospace Engineer,  
Cabin Safety and Environmental  
Systems Branch, ANM-150S, FAA,  
Seattle Aircraft Certification Office,  
1601 Lind Avenue SW., Renton, WA  
98057-3356; phone: 425-917-6585; fax:  
425-917-6590; email: *stanley.chen@  
faa.gov*.

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 747-8 airplanes. The NPRM published in the **Federal Register** on April 29, 2015 (80 FR 23739). The NPRM was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. The NPRM proposed to require installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. We are issuing this AD to prevent detachment of the quick-release pin, which could result in

separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

**Comment**

We gave the public the opportunity to participate in developing this AD. The following presents the comment received on the NPRM (80 FR 23739, April 29, 2015) and the FAA's response to each comment.

**Request To Revise Costs of Compliance Section**

Boeing asked that we add the parts cost to the cost table in the NPRM (80 FR 23739, April 29, 2015). Boeing stated that the parts cost per spacer is \$80, which increases the cost per product to \$1,100, and the cost on U.S. operators to up to \$2,200.

We agree with the commenter for the reason provided. We have included the parts cost and changed the amount of the cost per product and the cost on U.S. operators specified in the "Costs of Compliance" section of this final rule.

**Conclusion**

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this AD

with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (80 FR 23739, April 29, 2015) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (80 FR 23739, April 29, 2015).

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014. The service information describes procedures for installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this AD.

**Costs of Compliance**

We estimate that this AD affects 2 airplanes of U.S. registry.  
We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Spacer installations .....	Up to 12 work-hours × \$85 per hour = Up to \$1,020.	\$80 per spacer .....	Up to \$1,100 .....	Up to \$2,200

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:  
**Authority:** 49 U.S.C. 106(g), 40113, 44701.
- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):  
**2015-23-10 The Boeing Company:**  
Amendment 39-18326; Docket No.

**§ 39.13 [Amended]**

FAA-2015-0932; Directorate Identifier 2014-NM-205-AD.

**(a) Effective Date**

This AD is effective December 28, 2015.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 747-8 series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

**(d) Subject**

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

**(e) Unsafe Condition**

This AD was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. We are issuing this AD to prevent detachment of the quick-release pin, which could result in separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Installation**

Within 36 months after the effective date of this AD: Install a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment, in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the Seattle ACO, send it to the attention of the person identified in paragraph (i) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (h)(3)(i) and (h)(3)(ii) apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to

comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(i) Related Information**

For more information about this AD, contact Stanley Chen, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6585; fax: 425-917-6590; email: [stanley.chen@faa.gov](mailto:stanley.chen@faa.gov).

**(j) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

(ii) Reserved.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on November 4, 2015.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-28897 Filed 11-19-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HEALTH AND HUMAN SERVICES

### Food and Drug Administration

#### 21 CFR Part 150

[Docket No. FDA-1997-P-0007 (formerly Docket No. 1997P-0142)]

#### Artificially Sweetened Fruit Jelly and Artificially Sweetened Fruit Preserves and Jams; Revocation of Standards of Identity

**AGENCY:** Food and Drug Administration, HHS.

**ACTION:** Final rule.

**SUMMARY:** The Food and Drug Administration (FDA or we) is revoking the standards of identity for artificially sweetened jelly, preserves, and jams. We are taking this action primarily in response to a citizen petition submitted by the International Jelly and Preserve Association (IJPA). We also are taking this action because these standards are obsolete and unnecessary in light of our regulations for foods named by use of a nutrient content claim and a standardized term. This action will promote honesty and fair dealing in the interest of consumers.

**DATES:** The final rule is effective on November 20, 2015.

**FOR FURTHER INFORMATION CONTACT:**

Terri Wenger, Center for Food Safety and Applied Nutrition (HFS-820), Food and Drug Administration, 5100 Paint Branch Pkwy., College Park, MD 20740, 240-402-2371.

**SUPPLEMENTARY INFORMATION:**

#### I. Background

For more than 50 years, we have maintained standards of identity for fruit jelly (jelly) (§ 150.140 (21 CFR 150.140)) and fruit preserves and jams (preserves and jams) (§ 150.160). The standards establish the common or usual name for these products and provide that these products may contain nutritive sweeteners (e.g., sugar). In 1959, we added new standards of identity for artificially sweetened fruit jelly (artificially sweetened jelly) (§ 150.141) and artificially sweetened fruit preserves and jams (artificially sweetened preserves and jams) (§ 150.161) (24 FR 8896; October 31, 1959) that permit the use of non-nutritive sweeteners (e.g., saccharin). Notably, §§ 150.141 and 150.161 limit the types of non-nutritive sweeteners that can be used in products that are governed by those standards of identity. Under §§ 150.141 and 150.161, such products may only use saccharin,