

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (i) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(i) Related Information**

(1) For more information about this AD, contact Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

(2) Refer to MCAI EASA AD No.: 2017-0120, dated July 13, 2017, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0640.

**(j) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Diamond Aircraft Industries GmbH Mandatory Service Bulletin MSB 42-120/2, dated June 7, 2017.

(ii) Diamond Aircraft Industries GmbH Work Instruction WI-MSB 42-120, Revision 3, dated July 6, 2017.

(3) For Diamond Aircraft Industries GmbH service information identified in this AD, contact Diamond Aircraft Industries GmbH, N.A. Otto-Straße 5, A-2700 Wiener Neustadt, Austria, telephone: +43 2622 26700; fax: +43 2622 26780; email: [office@diamond-air.at](mailto:office@diamond-air.at); Internet: <http://www.diamondaircraft.com>.

(4) You may view this service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for locating Docket No. FAA-2017-0640.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

**Appendix to AD 2017-15-09**

Airplane Serial Number: \_\_\_\_\_  
Total Hours TIS of the Airplane: \_\_\_\_\_  
Total Hours TIS Since Clamp was Installed: \_\_\_\_\_  
Clamp was installed on: \_\_\_\_\_

\_\_\_\_ Left-hand Engine Only  
\_\_\_\_ Right-hand Engine Only  
\_\_\_\_ Both Engines

Number of Inspections Since Found Cracked: \_\_\_\_\_

Clamp installed per: \_\_\_\_\_ Section 8, \_\_\_\_\_ Section 9, or \_\_\_\_\_ Section 10 of subsection III.2 of Diamond Aircraft Industries GmbH Work Instruction WI-MSB 42-120, Revision 3, dated July 6, 2017.

Clamp installed per the following Revision level of Diamond Aircraft Industries GmbH Work Instruction WI-MSB 42-120:

\_\_\_\_ Original Issue  
\_\_\_\_ Revision 1  
\_\_\_\_ Revision 2

Issued in Kansas City, Missouri, on July 19, 2017.

**Melvin Johnson,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-15669 Filed 7-31-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2017-0331; Directorate Identifier 2016-NM-213-AD; Amendment 39-18971; AD 2017-15-11]**

**RIN 2120-AA64**

**Airworthiness Directives; Bombardier, Inc., Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc., Model DHC-8-102, -103, -106, -201, -202, -301, -311, and -315 airplanes. This AD was prompted by reports of undamped main landing gear (MLG) extension in-service. This AD requires replacement of the MLG retraction actuator rod-ends on both MLG assemblies. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective September 5, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of September 5, 2017.

**ADDRESSES:** For service information identified in this final rule, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0331.

*www.bombardier.com*. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0331.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0331; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:**

Fabio Buttitta, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7303; fax 516-794-5531.

**SUPPLEMENTARY INFORMATION:****Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc., Model DHC-8-102, -103, -106, -201, -202, -301, -311, and -315 airplanes. The NPRM published in the **Federal Register** on May 2, 2017 (82 FR 20453) ("the NPRM"). The NPRM was prompted by reports of undamped MLG extension in-service. The NPRM proposed to require replacement of the MLG retraction actuator rod-ends on both MLG assemblies. We are issuing this AD to prevent MLG undamped extensions, which could result in MLG structural failure, resulting in an unsafe asymmetric landing gear configuration.

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2016-36, dated November 22, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition

for certain Bombardier, Inc., Model DHC-8-102, -103, -106, -201, -202, -301, -311, and -315 airplanes. The MCAI states:

Two cases of undamped main landing gear (MLG) extension were reported in-service. Investigation determined that the MLG retraction actuator rod-ends failed as a result of non-conforming threads. This condition, if not corrected, could lead to additional MLG undamped extensions, which may result in MLG structural failure, resulting in an unsafe asymmetric landing gear configuration.

This [Canadian] AD mandates the replacement of the MLG retraction actuator rod-end subassemblies manufactured with non-conforming threads with units that fully conform to the design requirements.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0331.

## Comments

We gave the public the opportunity to participate in developing this AD. We considered the comment received. Air Line Pilots Association, International supported the NPRM.

## Conclusion

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

## ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement .....	3 work-hours × \$85 per hour = \$255 .....	\$2,078	\$2,333	\$212,303

## Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2017-15-11 Bombardier, Inc.:** Amendment 39-18971; Docket No. FAA-2017-0331; Directorate Identifier 2016-NM-213-AD.

## Related Service Information Under 14 CFR Part 51

Bombardier, Inc., issued Service Bulletin 8-32-179, Revision A, dated March 9, 2017. This service information describes procedures for replacing the MLG retraction actuator rod-ends on both MLG assemblies with units that fully conform to the design requirements. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

## Costs of Compliance

We estimate that this AD affects 91 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

### (a) Effective Date

This AD is effective September 5, 2017.

### (b) Affected ADs

None.

### (c) Applicability

This AD applies to Bombardier, Inc., Model DHC-8-102, -103, -106, -201, -202, -301, -311, and -315 airplanes, certificated in any category, serial numbers 003 through 672 inclusive, equipped with main landing gear (MLG) retraction actuator assembly part number 10500-101, -103, -501, -551, or -553.

### (d) Subject

Air Transport Association (ATA) of America Code 32, Landing Gear.

### (e) Reason

This AD was prompted by reports of undamped MLG extension in-service. We are issuing this AD to prevent MLG undamped extensions, which could result in MLG structural failure, resulting in an unsafe asymmetric landing gear configuration.

### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

### (g) Replacement of MLG Retraction Actuator Rod-Ends

At the applicable time specified in paragraph (g)(1) or (g)(2) of this AD: Replace the MLG retraction actuator rod-ends on both MLG assemblies, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 8-32-179, Revision A, dated March 9, 2017.

(1) For MLG retraction actuator assemblies with 37,000 total flight cycles or more as of the effective date of this AD: Within 18 months or 2,700 flight cycles, whichever occurs first after the effective date of this AD.

(2) For MLG retraction actuator assemblies with fewer than 37,000 total flight cycles as of the effective date of this AD: Within 24 months or 3,600 flight cycles, whichever occurs first after the effective date of this AD.

**(h) Alternative Installation of Part Number (P/N) 10500-105, -503, or -555**

Installation of MLG retraction actuator assembly P/N 10500-105, -503, or -555 on both MLGs is acceptable for compliance with the replacement required by paragraph (g) of this AD.

**(i) Credit for Previous Actions**

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 8-32-179, dated July 10, 2015.

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(k) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2016-36, dated November 22, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0331.

(2) For more information about this AD, contact Fabio Buttitta, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7303; fax 516-794-5531.

(3) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (l)(3) and (l)(4) of this AD.

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 8-32-179, Revision A, dated March 9, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on July 14, 2017.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-15476 Filed 7-31-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2017-0333; Directorate Identifier 2017-NM-005-AD; Amendment 39-18974; AD 2017-15-14]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Bombardier, Inc. (Type Certificate Previously Held by Canadair Limited) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc., Model CL-215-6B11 (CL-415 Variant) airplanes. This AD was prompted by a report indicating that an oxygen bottle was found loose while the clamp strap was in the locked

position. This AD requires modification of the clamp strap and installation of additional shims, as applicable, to the flight crew's oxygen bottles' retaining structures. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective September 5, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of September 5, 2017.

**ADDRESSES:** For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0333.

#### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0333; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### **FOR FURTHER INFORMATION CONTACT:**

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7318; fax 516-794-5531.

#### **SUPPLEMENTARY INFORMATION:**

##### **Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc., Model CL-215-6B11 (CL-415 Variant) airplanes. The NPRM published in the