

requirements of this AD, the phrase “after the effective date of this AD” must be used.

(2) Where Boeing Alert Service Bulletin 737–53A1240, Revision 2, dated November 2, 2016, specifies contacting Boeing, and specifies that action as RC: This AD requires using a method approved in accordance with the procedures specified in paragraph (s) of this AD.

(r) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (p) of this AD, if those actions were performed before the effective date of this AD using Boeing Alert Service Bulletin 737–53A1240, Revision 1, dated June 29, 2010, provided the conditions specified in paragraphs (r)(1) and (r)(2) of this AD are met and except as provided by paragraph (r)(3) of this AD. Boeing Alert Service Bulletin 737–53A1240, Revision 1, dated June 29, 2010, was incorporated by reference in AD 2012–12–05.

(1) Note 1 of paragraph 3.A of the Accomplishment Instructions of Boeing Alert Service Bulletin 737–53A1240, Revision 1, dated June 29, 2010, was disregarded when accomplishing the actions.

(2) Boeing Drawing 65–88700 was not used when accomplishing the actions in accordance with the Work Instructions of Boeing Alert Service Bulletin 737–53A1240, Revision 1, dated June 29, 2010.

(3) The access and restoration instructions identified in the Work Instructions of Boeing Alert Service Bulletin 737–53A1240, Revision 1, dated June 29, 2010, are not required. Operators are allowed to perform those actions in accordance with approved maintenance procedures.

(s) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles Aircraft Certification Office (ACO) Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (t)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (q)(2) of this AD: For service information that contains steps that are labeled as Required

for Compliance (RC), the provisions of paragraphs (s)(4)(i) and (s)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(t) Related Information

(1) For more information about this AD, contact Galib Abumeri, Aerospace Engineer, Airframe Branch, ANM–120L, FAA, Los Angeles Aircraft Certification Office (ACO) Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5324; fax: 562–627–5210; email: galib.abumeri@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on August 2, 2017.

Jeffrey E. Duven,

Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2017–16776 Filed 8–14–17; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2017–0773; Product Identifier 2017–NM–067–AD]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series

airplanes. This proposed AD was prompted by reports of cracks found in the lower chord of the left wing rear spar. This proposed AD would require repetitive inspections for cracking of the lower chord of the rear spar and lower aft skin at wing buttock line (WBL) 157 and applicable on-condition actions. We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by September 29, 2017.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0773.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0773; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles Aircraft Certification Office (ACO)

Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5313; fax: 562–627–5210; email: payman.soltani@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the ADDRESSES section. Include “Docket No. FAA–2017–0773; Product Identifier 2017–NM–067–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We have received reports indicating that a crack was found in the horizontal flange of the lower chord of the left wing rear spar at WBL 157 during a non-destructive test (NDT) at 53,841 total flight cycles and 66,268 total flight hours. Similar cracks have been reported on other Boeing airplanes that have accumulated between 63,550 and 69,285 total flight cycles. Analysis has

shown that main landing gear (MLG) loading and braking loads result in cyclic fatigue and local stresses on the structure. Concentrated loading due to the back-to-back design of the MLG fitting also contributes to the problem. This condition, if not corrected, could lead to the inability of the lower chord of the rear spar, a principal structural element, to sustain limit load, which could adversely affect the structural integrity of the airplane.

Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017. The service information describes procedures for repetitive low frequency eddy current (LFEC) inspections for cracking of the lower chord of the rear spar and detailed inspections for cracking of the lower aft skin at WBL 157, applicable on-condition actions (e.g., repair), and instructions for airplanes that have an existing repair in the inspection area. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishment of the actions identified as “RC” (required for compliance) in the Accomplishment Instructions of Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0773.

Explanation of Applicability

Model 737 airplanes having line numbers 1 through 291 have a limit of validity (LOV) of 34,000 total flight cycles, and the actions proposed in this NPRM, as specified in Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, would be required at a compliance time occurring after that LOV. Although operation of an airplane beyond its LOV is prohibited by 14 CFR 121.1115 and 129.115, this NPRM would include those airplanes in the applicability so that these airplanes are tracked in the event the LOV is extended in the future.

Costs of Compliance

We estimate that this proposed AD affects 190 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS				
Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
LFEC and detailed inspections	10 work-hours × \$85 per hour = \$850 per inspection cycle.	\$0	\$850 per inspection cycle.	Up to \$161,500 per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

We have received no definitive data that would enable us to provide cost estimates for the instructions for airplanes that have an existing repair in the inspection area specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This

proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2017–0773; Product Identifier 2017–NM–067–AD.

(a) Comments Due Date

We must receive comments by September 29, 2017.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by the report of a crack indication in the horizontal flange of the lower chord of the left wing rear spar at wing buttock line (WBL) 157 and multiple reports of similar crack findings on other

airplanes. We are issuing this AD to detect and correct cracking of the lower chord of the rear spar and the lower aft skin at WBL 157. Undetected cracks could lead to the inability of the lower chord of the rear spar, a principal structural element, to sustain limit load, which could adversely affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) For Group 2 airplanes identified in Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017: Except as required by paragraph (h) of this AD, at the applicable times specified in paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017.

(2) For Group 1 airplanes identified in Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017: Within 120 days after the effective date of this AD, inspect the airplane and do all applicable corrective actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, uses the phrase “after the original issue date of this service bulletin,” for purposes of determining compliance with the requirements of this AD, the phrase “after the effective date of this AD” must be used.

(2) Where Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, specifies contacting Boeing, and specifies that action as RC: This AD requires using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has

been authorized by the Manager, Los Angeles ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h)(2) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(j) Related Information

(1) For more information about this AD, contact Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5313; fax: 562–627–5210; email: payman.soltani@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on August 2, 2017.

Jeffrey E. Duven,

Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2017–16774 Filed 8–14–17; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF HOMELAND SECURITY

Coast Guard

33 CFR Part 110

[Docket Number USCG–2015–0549]

RIN 1625–AA01

Anchorage Grounds; Galveston Harbor, Bolivar Roads Channel, Galveston, Texas

AGENCY: Coast Guard, DHS.

ACTION: Notice of proposed rulemaking.