

may view this referenced service information at the FAA, Engine & Propeller Standards Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781-238-7759.

Issued in Burlington, Massachusetts, on August 30, 2019.

**Karen M. Grant,**

*Acting Manager, Engine and Propeller Standards Branch, Aircraft Certification Service.*

[FR Doc. 2019-19169 Filed 9-5-19; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2019-0671; Product Identifier 2019-NM-080-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 787-8 airplanes. This proposed AD was prompted by a report of fatigue cracking in the lug root radius of a main landing gear (MLG) aft hanger link lug fitting. This proposed AD would require surface high frequency eddy current (HFEC) inspections of the left and right side MLG aft hanger link lug fitting for cracking, and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 21, 2019.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0671.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0671; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3529; email: [greg.rutar@faa.gov](mailto:greg.rutar@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2019-0671; Product Identifier 2019-NM-080-AD" at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

The FAA will post all comments received, without change, to <http://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this proposed AD.

#### Discussion

The FAA has received a report indicating that fatigue cracking was

found in the lug root radius of the left side MLG aft hanger link lug fitting during full scale fatigue testing. The cracking was found at 144,445 flight cycles and had a maximum length of 1.70 inches at the end of the test (165,000 flight cycles). Analysis completed during the investigation of the cracking indicates that similar cracks could develop on in-service aircraft. This condition, if not addressed, could result in undetected fatigue cracks that can grow and weaken the primary structure such that it cannot sustain limit load, which could adversely affect the structural integrity of the airplane.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin B787-81205-SB530070-00 RB, Issue 001, dated August 31, 2018. The service information describes procedures for repetitive HFEC inspections of the left and right side aft hanger link lug fitting at the lug root radius for cracking and applicable on-condition actions. On-condition actions include repair.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination

The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishment of the actions identified in Boeing Alert Requirements Bulletin B787-81205-SB530070-00 RB, Issue 001, dated August 31, 2018, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0671.

#### Costs of Compliance

The FAA estimates that this proposed AD affects 7 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

## ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Repetitive HFEC inspections	3 work-hours × \$85 per hour = \$255 per inspection cycle.	\$0	\$255 per inspection cycle .....	\$1,785 per inspection cycle.

The FAA has received no definitive data that would enable the agency to provide cost estimates for the on-condition actions specified in this proposed AD.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

#### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the

national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA–2019–0671; Product Identifier 2019–NM–080–AD.

##### (a) Comments Due Date

The FAA must receive comments by October 21, 2019.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to The Boeing Company Model 787–8 airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin B787–81205–SB530070–00 RB, Issue 001, dated August 31, 2018.

##### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

##### (e) Unsafe Condition

This AD was prompted by a report of fatigue cracking in the lug root radius of a

main landing gear (MLG) aft hanger link lug fitting. The FAA is issuing this AD to address fatigue cracking in the left and right side MLG aft hanger link lug fittings. This condition, if not addressed, could result in undetected fatigue cracks that can grow and weaken the primary structure such that it cannot sustain limit load, which could adversely affect the structural integrity of the airplane.

##### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

##### (g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin B787–81205–SB530070–00 RB, Issue 001, dated August 31, 2018, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin B787–81205–SB530070–00 RB, Issue 001, dated August 31, 2018.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin B787–81205–SB530070–00, Issue 001, dated August 31, 2018, which is referred to in Boeing Alert Requirements Bulletin B787–81205–SB530070–00 RB, Issue 001, dated August 31, 2018.

##### (h) Exceptions to Service Information Specifications

Where Boeing Alert Requirements Bulletin B787–81205–SB530070–00 RB, Issue 001, dated August 31, 2018, specifies contacting Boeing for repair instructions: This AD requires doing the repair using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

##### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair,

modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

#### (j) Related Information

(1) For more information about this AD, contact Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3529; email: [greg.rutar@faa.gov](mailto:greg.rutar@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on August 23, 2019.

**Suzanne Masterson,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019-19054 Filed 9-5-19; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2019-0673; Product Identifier 2019-NM-101-AD]

**RIN 2120-AA64**

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2014-24-07, which applies to certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; A320-211, -212, -214, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2014-24-07 requires repetitive rototest inspections for cracking; corrective actions if necessary; and modification of the torsion box, which terminates the repetitive inspections. Since the FAA

issued AD 2014-24-07, the FAA has determined that the compliance times for the repetitive inspections must be revised for certain airplanes. This proposed AD would retain the actions of AD 2014-24-07, with certain revised compliance times, as specified in a European Aviation Safety Agency (EASA) AD, which will be incorporated by reference. This proposed AD would also revise the applicability to include additional airplanes. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 21, 2019.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material identified in this proposed AD that will be incorporated by reference (IBR), contact the EASA, at Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <http://www.regulations.gov>.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0673; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be

available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2019-0673; Product Identifier 2019-NM-101-AD" at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM based on those comments.

The FAA will post all comments, without change, to <http://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact the agency receives about this NPRM.

#### Discussion

The FAA issued AD 2014-24-07, Amendment 39-18040 (79 FR 72124, December 5, 2014) ("AD 2014-24-07"), for certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; A320-211, -212, -214, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232 airplanes. AD 2014-24-07 requires repetitive rototest inspections for cracking; corrective actions if necessary; and modification of the torsion box, which terminates the repetitive inspections. AD 2014-24-07 resulted from a report of a crack found in the fuselage during a fatigue test campaign. The FAA issued AD 2014-24-07 to address cracking in the side box beam flange of the fuselage, which could affect the structural integrity of the airplane.

#### Actions Since AD 2014-24-07 Was Issued

Since the FAA issued AD 2014-24-07, the compliance times for the repetitive inspections have been reduced for airplanes with a retrofit sharklet installation with non-structural reinforcement.

The EASA, which is the Technical Agent for the Member States of the