

**Applicability**

(c) This AD applies to Fokker Services B.V. Model F.27 Mark 050, 200, 300, 400, 500, 600, and 700 airplanes; Fokker Services B.V. Model F.28 Mark 0070, 0100, 1000, 2000, 3000, and 4000 airplanes; certificated in any category; all serial numbers.

**Note 1:** This AD requires revisions to certain operator maintenance documents to include a new Critical Design Configuration Control Limitation (CDCCL). Compliance with this CDCCL is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by this AD, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance (AMOC) according to paragraph (j)(1) of this AD. The request should include a description of

changes to the required inspections that will ensure the continued operational safety of the airplane.

**Subject**

(d) Air Transport Association (ATA) of America Code 28: Fuel.

**Reason**

(e) The mandatory continuing airworthiness information (MCAI) states: [T]he Federal Aviation Administration (FAA) has published Special Federal Aviation Regulation (SFAR) 88, and the Joint Aviation Authorities (JAA) have published Interim Policy INT/POL/25/12. The review conducted by Fokker Services on the Fokker F27 and F28 type designs in response to these regulations revealed that, under certain failure conditions, a short circuit can develop in the fuel pilot valve solenoid or in the wiring to the solenoid. Such a short circuit

may result in an ignition source in the wing tank vapour space.

This condition, if not corrected, could result in a wing fuel tank explosion and consequent loss of the aeroplane.

\* \* \* \* \*

**Compliance**

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Installation of Fuses Packed in Jiffy Junctions**

(g) Within 24 months after the effective date of this AD, re-work the wiring and install the fuses packed in jiffy junctions (i.e., crimped wire in-line junction device), in accordance with the Accomplishment Instructions of the applicable Fokker service bulletin identified in table 1 of this AD.

TABLE 1—*Service Bulletins*

Fokker Service Bulletin—	Dated—
SBF50–28–024, including Drawing W7916–057, Sheets 006 and 007, Issue E, dated June 23, 2010, Drawing W7987–520, Sheets 1 and 2, dated October 24, 2005, and Manual Change Notification—Maintenance Document MCNM–F50–070, dated June 23, 2010.	June 23, 2010.
SBF28–28–051, including Drawing W57231, Sheets 010 and 011, Issue K, dated June 23, 2010, Drawing W58048, Sheet 2, dated April 29, 2010, and Manual Change Notification—Maintenance Document MCNM–F28–034, dated June 23, 2010.	June 23, 2010.
SBF27–28–069, including Drawing W7202–138, Sheets 001 and 002, Issue B, dated June 23, 2010, and Manual Change Notification—Maintenance Document MCNM–F27–025, dated June 23, 2010.	June 23, 2010.
SBF100–28–042, including Drawing W41192, Sheet 012, Issue AG, dated June 23, 2010, Drawing W59520, Sheet 1, Issue A, dated April 29, 2010, and Manual Change Notification—Maintenance Document MCNM–F100–129, dated June 23, 2010.	June 23, 2010.

**Critical Design Configuration Control Limitation (CDCCL)**

(h) Before further flight after doing the actions required by paragraph (g) of this AD: Revise the aircraft maintenance program by incorporating the CDCCL specified in paragraph 1.L.(1)(c) of the applicable Fokker service bulletins identified in table 1 of this AD.

**No Alternative Actions, Intervals, and/or CDCCLs**

(i) After accomplishing the revision required by paragraph (h) of this AD, no alternative CDCCLs may be used unless the CDCCLs are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j) of this AD.

**FAA AD Differences**

**Note 2:** This AD differs from the MCAI and/or service information as follows: Although European Aviation Safety Agency (EASA) Airworthiness Directive 2010–0195, dated September 29, 2010, specifies revising the maintenance program to include maintaining CDCCLs, this AD only requires the revision. Requiring a revision of the maintenance program, rather than requiring maintaining CDCCLs, requires operators to record AD compliance only at the time the revision is made. Maintaining CDCCLs specified in the airworthiness limitations must be complied with in accordance with 14 CFR 91.403(c).

**Other FAA AD Provisions**

(j) The following provisions also apply to this AD:

(1) Alternative Methods of Compliance: The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA 1601 Lind Avenue, SW., Renton, Washington 98057–3356; telephone 425–227–1137; fax 425–227–1149. Information may be e-mailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Airworthy Product: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**Related Information**

(k) Refer to MCAI EASA Airworthiness Directive 2010–0195, dated September 29, 2010, and the Fokker service bulletins identified in table 1 of this AD, for related information.

Issued in Renton, Washington, on June 14, 2011.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2011–15360 Filed 6–20–11; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. Docket No. FAA–2011–0527; Airspace Docket No. 11–AWA–2]

**RIN 2120–AA66**

**Proposed Amendment of Class C Airspace; Palm Beach International Airport, FL**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to modify the Palm Beach International Airport Class C airspace area by raising the floor of Class C airspace above Palm Beach County Park Airport (LNA) from 1,200 feet MSL to 1,600 feet MSL. The FAA is proposing this action to enhance safety and enable more efficient operations at LNA.

**DATES:** Comments must be received on or before August 22, 2011.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, M-30, 1200 New Jersey Avenue, SE., West Building Ground Floor, Room W12-140, Washington, DC 20590-0001; *telephone:* (202) 366-9826. You must identify FAA Docket No. FAA-2011-0527 and Airspace Docket No. 11-AWA-2, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>

**FOR FURTHER INFORMATION CONTACT:** Paul Gallant, Airspace, Regulations and ATC Procedures Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue, SW., Washington, DC 20591; *telephone:* (202) 267-8783.

#### **SUPPLEMENTARY INFORMATION:**

##### **Comments Invited**

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-2011-0527 and Airspace Docket No. 11-AWA-2) and be submitted in triplicate to the Docket Management Facility (see **ADDRESSES** section for address and phone number). You may also submit comments through the Internet at <http://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Nos. FAA-2011-0527 and Airspace Docket No. 11-AWA-2." The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified closing date for comments will be considered before

taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. All comments submitted will be available for examination in the public docket both before and after the closing date for comments. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

##### **Availability of NPRMs**

An electronic copy of this document may be downloaded through the Internet at <http://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's web page at [http://www.faa.gov/regulations\\_policies/rulemaking/recently\\_published/](http://www.faa.gov/regulations_policies/rulemaking/recently_published/)

You may review the public docket containing the proposal, any comments received and any final disposition in person in the Dockets Office (see **ADDRESSES** section for address and phone number) between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. An informal docket may also be examined during normal business hours at the office of the Eastern Service Center, Federal Aviation Administration, Room 210, 1701 Columbia Ave., College Park, GA 30337.

Persons interested in being placed on a mailing list for future NPRMs should contact the FAA's Office of Rulemaking, (202) 267-9677, for a copy of Advisory Circular No. 11-2A, Notice of Proposed Rulemaking Distribution System, which describes the application procedure.

##### **The Proposal**

The FAA is proposing an amendment to Title 14, Code of Federal Regulations (14 CFR) part 71 to modify the Palm Beach International Airport Class C airspace area by raising the floor of Class C airspace to 1,600 feet MSL within an area overlying, and to the south of, the Palm Beach County Park Airport (see attached chart). Currently, the floor of Class C airspace in the vicinity of LNA is at 1,200 feet MSL. Raising the Class C floor as proposed would enhance safety by providing additional clearance between rotorcraft and fixed-wing aircraft entering the traffic pattern at LNA. This would allow fixed-wing aircraft entering the traffic pattern to safely overfly the existing helicopter patterns and also would allow LNA helicopter training activities to take place at higher altitudes. The boundaries would be depicted as subareas A, B, and C for clarity.

In addition, a minor correction is made to the geographic coordinates of

LNA to reflect the current information in the FAA's aeronautical database.

Class C airspace areas are published in paragraph 4,000 of FAA Order 7400.9U, dated August 18, 2010 and effective September 15, 2010, which is incorporated by reference in 14 CFR 71.1. The Class C airspace area modification proposed in this document would be published subsequently in the Order.

The FAA has determined that this proposed regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this proposed regulation: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under Department of Transportation (DOT) Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that will only affect air traffic procedures and air navigation, it is certified that this proposed rule, when promulgated, will not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority.

This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it modifies terminal airspace as required to preserve the safe and efficient flow of air traffic.

##### **List of Subjects in 14 CFR Part 71**

Airspace, Incorporation by reference, Navigation (air).

##### **The Proposed Amendment**

In consideration of the foregoing, the Federal Aviation Administration proposes to amend 14 CFR part 71 as follows:

**PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS**

1. The authority citation for part 71 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959–1963 Comp., p. 389.

**§ 71.1 [Amended]**

2. The incorporation by reference in 14 CFR 71.1 of the Federal Aviation Administration Order 7400.9U, Airspace Designations and Reporting Points, dated August 18, 2010, and effective September 15, 2010, is amended as follows:

*Paragraph 4000—Subpart C—Class C Airspace*

\* \* \* \* \*

**ASO FL C Palm Beach International Airport, FL [Amended]**

Palm Beach International Airport, FL  
(Lat. 26°40'59" N., long. 80°05'44" W.)  
Palm Beach County Park Airport  
(Lat. 26°35'35" N., long. 80°05'06" W.)

**Boundaries**

Area A. That airspace extending upward from the surface to and including 4,000 feet MSL within a 5-mile radius of Palm Beach International Airport, excluding that airspace within a 2-mile radius of the Palm Beach County Park Airport.

Area B. That airspace extending upward from 1,600 feet MSL to and including 4,000 feet MSL within an area bounded on the north by a line direct from the intersection of the Florida Turnpike (Highway 91) and Lantana Road to the intersection of a 5-mile radius of the Palm Beach International Airport and a 2-mile radius west of the Palm Beach County Park Airport and a 2-mile radius north of the Palm Beach County Park

Airport, on the east by a line direct from the intersection of a 5-mile radius of the Palm Beach International Airport and a 2-mile radius east of the Palm Beach County Park Airport to the intersection of a 10-mile radius of the Palm Beach International Airport and US 1, on the south by a 10-mile radius of the Palm Beach International Airport, and on the west by the Florida Turnpike.

Area C. That airspace extending upward from 1,200 feet MSL to and including 4,000 feet MSL within a 10-mile radius of the Palm Beach International Airport, excluding area B.


Issued in Washington, DC, on June 13, 2011.

**Gary A. Norek,**  
*Acting Manager, Airspace, Regulations and ATC Procedures Group.*

**BILLING CODE 4910–13–P**

# Proposed Modification of the Palm Beach International Airport Class C Airspace Area

Airspace Docket No. 11-AWA-2

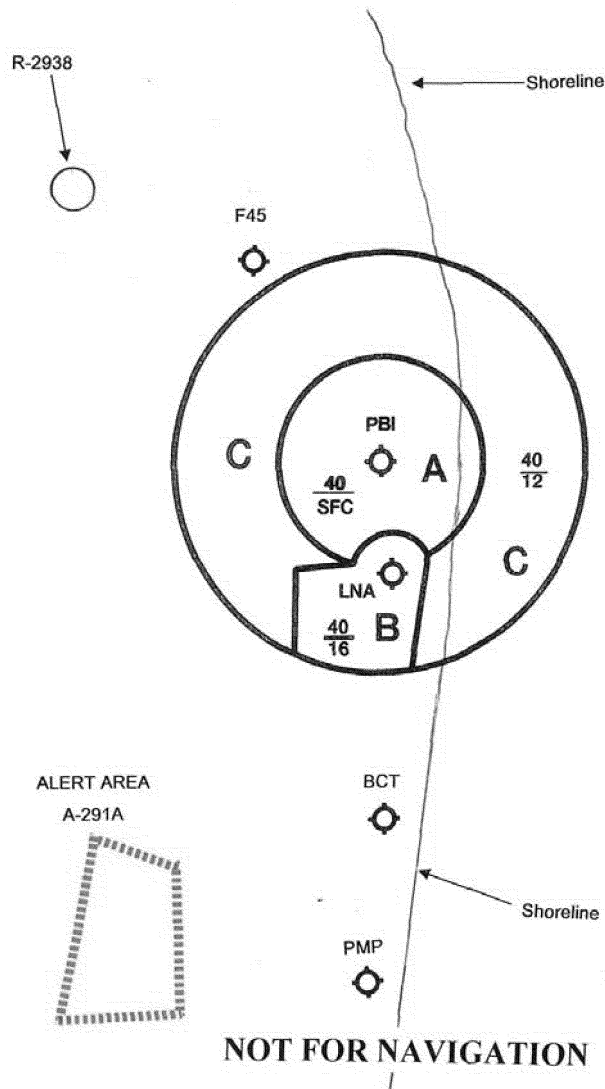

[FR Doc. 2011-15407 Filed 6-20-11; 8:45 am]  
BILLING CODE 4910-13-C

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2011-0439; Airspace  
Docket No. 11-ANM-10]

### Proposed Amendment of Class D and Class E Airspace and Establishment of Class E Airspace; Casper, WY

AGENCY: Federal Aviation  
Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to amend Class D and Class E airspace at Casper, Natrona County International Airport, Casper, WY, by adjusting the geographic coordinates of the airport. This action also would establish Class E En Route Domestic airspace at the airport, to facilitate vectoring of Instrument Flight Rules (IFR) traffic from en route airspace to Casper, WY. The FAA is proposing this action to enhance the safety and management of aircraft operations at Casper, Natrona County International Airport.

**DATES:** Comments must be received on or before August 5, 2011.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590; telephone (202) 366-9826. You must identify FAA Docket No. FAA-2011-0439; Airspace Docket No. 11-ANM-10, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>.

**FOR FURTHER INFORMATION CONTACT:**  
Eldon Taylor, Federal Aviation  
Administration, Operations Support